



**HD Sharman Ltd.**  
High Peak Works  
Chapel-en-le-Frith  
High Peak, Derbyshire  
SK23 0HW

**T.** 01298 812371  
**E.** [info@hdsharman.co.uk](mailto:info@hdsharman.co.uk)  
**W.** [hdsharman.co.uk](http://hdsharman.co.uk)



**sharmans**  
gutter & roof refurbishment systems



**STANDARD METHOD STATEMENT POLYURETHANE MAINTENANCE SYSTEMS FOR CLADDING**

**SYSTEM SHEET C1-UK – Two pack high performance cladding maintenance system**

<b>Project – EXAMPLE ONLY Assessment on suitability must be made prior to use – If in doubt please consult with Tikkurila Technical Services</b>		
<b>Environment:</b> ISO C3	<b>Notes:</b>	Method Statement for re-painting existing plastisol coated external metal cladding
<b>Date:</b> 2019	<b>Prepared By:</b> Tim Haythornthwaite	
<p><b>Preparation Summary:</b></p> <p>The performance of this system will depend on the degree and thoroughness of the surface preparation.</p> <p><b>Mechanical Clean Preparation ISO ST3</b></p>	<p>Surfaces to be coated must be clean, sound, dry and free from contamination. Prior to paint application all surfaces must be assessed and treated in accordance with ISO 8504</p> <p>Replace all defective sheets with new to match existing. (All new replacement sheets must be solvent washed with 1006 thinner prior to application of new paint system to ensure removal of all residual plasticiser.)</p> <p>Treat all mould and algae growths with Tikkurila Mould Solution.</p> <p>All accumulated contamination, corrosion salts, chlorine, dirt, grease, oil to be removed by most appropriate means - ISO 12944-4. High pressure water blasting equipment with oscillating heads must be used to aid the cleaning and preparation process. Rinse well with clean water and allow to thoroughly dry.</p> <p>Strip/Remove all defective coatings back to sound original metal surface. All stripping to be done to nearest joint or natural break. NB: All defective coatings must be removed/Stripped to original metal</p> <p>Power disc damaged/ corroded areas to Min ST 3 standard (near white metal) (ISO 8501-1: 2007). Pay particular attention to sheet ends and other vulnerable areas. Rough edges to be feathered smooth to a firm edge.</p> <p>Re wash all prepared corroded areas to ensure all corrosion salt is removed. Lightly abrade to remove all white oxidation and to provide a 'key'. Surfaces must be free of all oxidation especially white salts before painting.</p> <p>Ensure that the surfaces are clean, sound and dry at the time of painting.</p>	



## Paint System

No of Coats	Product	Colour	DFT	Theo Spread Rate	Volume Solids	Thinner
1 or 2 x Primer to all bare metal as required	Temadur 20 – Two pack polyurethane anti-corrosive primer	To match finish	50um	11m/litre	57%	1048
1 x Full	Temadur 20 semi-matt or 50 semi-gloss – High performance two pack polyurethane solvent based finish	TBC	50um per coat	11m/litre/coat	57%-56%	1048
1 x Full	Temadur 20 semi-matt or 50 semi-gloss – High performance two pack polyurethane solvent based finish	TBC	50um per coat	11m/litre/coat	57%-56%	1048
		<b>DFT</b>	<b>200um</b>			

- Certain finish colours may require two topcoats to ensure opacity.

FIXINGS – Plastic caps should be removed and replaced with new to match existing colour. Fixings subject to corrosion should be replaced.

SHEET ENDS/CUT EDGES - Potentially vulnerable to early deterioration especially at any overlaps or areas that are difficult to prepare and protect. Exposed sheets ends must be cleaned and prepared as described above and any corroded areas patch primed with Temabond ST200 @ 100um DFT prior to main painting works. Due to design at these areas early failures can occur.

### Notes:

- Stripe coat all edges, bolts and difficult to spray areas to ensure thicknesses are achieved.
- Spread rates are theoretical and do not allow for wastage etc.
- Ensure coatings are well ventilated during curing and sufficiently cured before overcoating.
- Products to be used in accordance with relevant TDS.
- Dry film thicknesses must be in accordance with ISO19840
- Total Soluble Salt content on the steel should not exceed 40mg/m<sup>2</sup>(4ug/cm<sup>2</sup>) using the Bresle method to ISO8502-6/9 (DSM acceptable)





## MAINTENANCE

To help ensure life to 1<sup>st</sup> maintenance is achieved it is good practice to carry out routine inspection and maintenance of painted structures to help prolong the life of the applied system and keep it in good condition.

1 - Regular inspection of the work is recommended.

2 - Localised repairs should be carried out as appropriate. I.e. Mechanical damage etc. This must be touched up or repainted as appropriate equivalent to the specified system. Whilst efforts should be made to obtain the maximum degree of cosmetic appearance it should be recognised that such repairs may be visible.

3 - Regular washing/cleaning and repairs as required are recommended ideally on an annual basis or as appropriate dependant on environment.

## SUGGESTED REPAIR PROCEDURES:

Suggested Repair Procedures being suggested are for routine annual maintenance of coatings which have become damaged during life of the system and in the normal course of exposure when rust grade is Ri1-Ri3 (ISO 4628-3). These areas should receive a remedial system equivalent to the specified protective treatment. While efforts should be made to obtain the maximum degree of cosmetic appearance, it should be recognised that such repairs may be visible. Brush application is assumed. Spray application may require fewer coats, please consult Tikkurila for advice.

Areas of damaged coating should be prepared as per original instructions to a firm coating edge. Sound coating edges should be feathered back and all areas to be over painted including 50mm of adjacent coating should be thoroughly abraded to form a 'key' and cleaned down as necessary (depending on overcoating characteristics of existing coating). All remedial areas should be cleaned down as required to provide a clean, dry surface for coating. Repair coats should be carefully applied and should overlap existing coats by the 50mm prepared area, ensuring that existing coating edges are sealed. Consult relevant Product Data Sheets and Health & Safety Data Sheets

**HD Sharman Ltd.**  
High Peak Works  
Chapel-en-le-Frith  
High Peak, Derbyshire  
SK23 0HW

**T.** 01298 812371  
**E.** [info@hdsharman.co.uk](mailto:info@hdsharman.co.uk)  
**W.** [hdsharman.co.uk](http://hdsharman.co.uk)



**sharmans**  
gutter & roof refurbishment systems

TIKKURILA INDUSTRIAL UK  
VALTTI UNIT B3  
SOUTH GYLE CRESCENT LANE  
EDINBURGH EH12 9EG

TEL: +44 (0)131 334 4999  
FAX: +44 (0)131 334 3987  
EMAIL: [enquiries@valtti.co.uk](mailto:enquiries@valtti.co.uk)  
[www.valtti.co.uk](http://www.valtti.co.uk)



### Maintenance Coating Repair Summary:

	Type of Damage	Repair Procedure
A	Topcoat only damaged	Apply 1 coat of specified topcoat to 50um DFT
B	Topcoat and Intermediate coat damaged	Apply 1 or 2 coats as required Temadur 50 to 50um DFT per coat, followed by 1 coat of specified topcoat to 50um DFT. (For certain finish colours, more than one coat may be required).
C	Topcoat, Intermediate and Primer coats damaged, primer intact (no rusting)	Spot prime with 1 or 2 x Temadur 20 primer to 50umDFT per coat. Patch apply 1 coat of Temadur 50 to 50um DFT, followed by 1 coat of specified topcoat to 50um DFT. (For certain finish colours, more than one coat may be required).

It is important to ensure full film thicknesses are restored to those originally specified

This repair procedure is for general guidance only. If in doubt consult with relevant technical representatives before use

**HD Sharman Ltd.**  
High Peak Works  
Chapel-en-le-Frith  
High Peak, Derbyshire  
SK23 0HW

**T.** 01298 812371  
**E.** [info@hdsharman.co.uk](mailto:info@hdsharman.co.uk)  
**W.** [hdsharman.co.uk](http://hdsharman.co.uk)



**sharmans**  
gutter & roof refurbishment systems

TIKKURILA INDUSTRIAL UK  
VALTTI UNIT B3  
SOUTH GYLE CRESCENT LANE  
EDINBURGH EH12 9EG

TEL: +44 (0)131 334 4999  
FAX: +44 (0)131 334 3987  
EMAIL: [enquiries@valtti.co.uk](mailto:enquiries@valtti.co.uk)  
[www.valtti.co.uk](http://www.valtti.co.uk)



#### STANDARD IMPORTANT NOTES:

Full risk and Health & Safety assessment must be carried out to satisfy method statement and products are suitable prior to application.

Observe all data sheet instructions.

All good painting practices apply as described in BS 6150:1982 & ISO 12944, 8504 BS 5493 and all other relevant standards.

Thorough preparation is essential.

Do not apply products during damp, wet or frosty conditions.

During application and curing Surface should dry. Relative humidity should not exceed 80%. Steel surfaces must be 3°C above the dew point. Do not apply when rain, sleet, snow or mists are imminent.

All corrosion salts must be removed and steel chemically clean prior to painting. Testing for salts is desirable and allowances made for repeat washing made as appropriate.

All oil, grease, contamination etc. must be identified and removed prior to painting. Where cleaning has not successfully removed these deposits advice must be sought from appropriate technical services department.

Environmental conditions, temperature, humidity, ventilation must be carefully controlled and or monitored both during application and curing as required.

**HD Sharman Ltd.**  
High Peak Works  
Chapel-en-le-Frith  
High Peak, Derbyshire  
SK23 0HW

**T.** 01298 812371  
**E.** [info@hdsharman.co.uk](mailto:info@hdsharman.co.uk)  
**W.** [hdsharman.co.uk](http://hdsharman.co.uk)



**sharmans**  
gutter & roof refurbishment systems

TIKKURILA INDUSTRIAL UK  
VALTTI UNIT B3  
SOUTH GYLE CRESCENT LANE  
EDINBURGH EH12 9EG

TEL: +44 (0)131 334 4999  
FAX: +44 (0)131 334 3987  
EMAIL: [enquiries@valtti.co.uk](mailto:enquiries@valtti.co.uk)  
[www.valtti.co.uk](http://www.valtti.co.uk)



Shop applied primers must be over coated as soon as possible after application taking note of maximum exposure times and over coating limits.

Regular inspection is recommended and repairs carried out as appropriate. i.e. Mechanical damage etc. This will help prevent premature deterioration.

Regular periodic washing will also help extend the life of the applied paint systems.

Application by brush may result in lower film thicknesses and additional coats may be required to achieve required film thickness.

Mastics and fillers – All defective mastics and fillers must be replaced or installed where required with appropriate mastic/filler/silicone sealant compatible with the paint system proposed

Any specification provided is our best recommendation from the information supplied and is given in good faith but without warranty or liability. We recommend a trial area is coated to ensure the product meets your requirements.

**HD Sharman Ltd.**  
High Peak Works  
Chapel-en-le-Frith  
High Peak, Derbyshire  
SK23 0HW

**T.** 01298 812371  
**E.** [info@hdsharman.co.uk](mailto:info@hdsharman.co.uk)  
**W.** [hdsharman.co.uk](http://hdsharman.co.uk)



**sharmans**  
gutter & roof refurbishment systems

TIKKURILA INDUSTRIAL UK  
VALTTI UNIT B3  
SOUTH GYLE CRESCENT LANE  
EDINBURGH EH12 9EG

TEL: +44 (0)131 334 4999  
FAX: +44 (0)131 334 3987  
EMAIL: [enquiries@valtti.co.uk](mailto:enquiries@valtti.co.uk)  
[www.valtti.co.uk](http://www.valtti.co.uk)